



AN EXCHANGE OF TECHNICAL INFORMATION

Number: TL006 - 2025
Subject: Menu and Read File

Released: October 22, 2025

In alignment with TL003 – 2025 (New Menu0118 and Read0517 file) it is important to use latest menu file (menu0118+) and read file (READ0517+) or greater.

These files are loaded within the zip file of each ML3 software release (51XX - ThinLINE®, 53XX - PrimeLINE® & EliteLINE®, 57xx - NaturaLINE®), pictured below. It is recommended that the complete zip folder is downloaded and all of the subfiles be extracted onto the USB. The menu and read files are periodically updated. They are included within the **software zip files**. Below is a picture of the current software as of this TechLINE's release.

Unit	Software Version
All units for the MST/MUA Tool	See below for Version Numbers
EliteLINE / PrimeLINE (NOT TO BE USED ON MAERSK UNITS)	5390 with 241215.cf3
NaturaLINE	5716 with 241215.cf3
ThinLINE	5190 with 241215.cf3

If you are unsure as to what files you have, the listed files can be downloaded from the Carrier Public website at <https://www.carrier.com/container-refrigeration/en/worldwide/products/data-tools/#tab-7>.

When loading software onto the unit, the latest configuration at time of release will also be loaded. If at a later time a newer configuration is released, it should be loaded after uploading software. For example: if software scr1539X came with configuration cf250131 (YYMMDD) and later configuration cf250315 was released; load 539X first and then 250315. If 250315 is loaded first and then 539X is loaded, then the system will boot up with the previous configuration (250131) and not implement any changes made in the latest configuration.

Once the software is uploaded, do not revert to a previous version as this can result in data errors.

To summarize, the below points should be followed:

- **Use only Carrier authorized tools such as the MST (07-00572-00)**
- **Use the latest version of ContainerLINK (available on your device's app store)**
- **Use the most up to date Menu and Read files (currently Menu0118, Read0517)**
- **After loading software, ensure unit setpoint and configuration remains unchanged.**

Alternate non-Carrier interrogation or software uploading tools can result in data errors, similar to what was noted in TL003-2025 when using an older version of the 2 files.

Service Engineering / Container Products

Please circulate copies of this bulletin to all service and management personnel as soon as possible.
